

Work Order ID 126869

Thursday, November 27, 2014 11:02:54 AM

126869 Ship Dec 17

Page 1

Item ID: D4680-041

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Skidtube Assembly

Start Date: 11/27/2014 Start Qty: 1.00

1

Cust Item ID:

Required Date: 11/27/2014 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

MLS

Date: 11-11-27

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

Draw Nbr

Revision Nbr

D3492

E

D4680

E/D per ECN 15-551 UMC 15-6-25

110

0.00

110

CNC Bend 1

Memo

0.00

CNC Delta 100 Bender

1- Bend as per dwg D4680 using bend program D4680 and Folio: 26

Verify measurement before cutting.

2- Cut FWD end as per dwg D4680

14-12-1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126869

Thursday, November 27, 2014 11:02:54 AM

126869

Page 2

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 11/27/2014 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/2014 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120	Skidtubes	0.00							
120									
Skidtubes	Memo	0.00							
Skidtubes	1-Cut Aft end as per dwg D4680								
	2-Deburr ends								
	3-Drill Aft & Fwd Cap holes using DT8678 & DT8901								
	4-Locate DT_____ & Drill Ground wire hole on top of Tube.								
	5-Locate DT_____ with #30 cleco in Ground wire hole ,then Pilot Drill all X-Bolt holes using #30" drill.***DO NOT OPEN AFT CAP HOLES****								
	6-Open ground wire hole .297" (1 at fwd end & 2 at aft end at 21.06" ref.)								
	8- 3 most fwd x-bolt holes must be laid out manually, open to #30.								
	9-Open Aft & Fwd Cap holes using .208" drill.								
	10- Open X-Bolt holes to .750" (8 places) ***DO NOT OPEN HOLES TO SECTION G-G ***								
	11- Drill Rivet Holes as per Dwg D4680 using DT10065 ***DO NOT DRILL RIVET HOLES ON SECTION G-G (TWO PLACES)								
	12-Deburr holes.								



DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126869

Thursday, November 27, 2014 11:02:54 AM

126869

Page 3

Item ID: D4680-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Skidtube Assembly

Start Date: 11/27/2014 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 11/27/2014 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	QC5- Inspect part completeness to step on W/O	0.00							
140									
QC	Memo	0.00							

Quality Control

14-12-04

150	Chemical Conversion Coat per QSI005 4.1	0.00							
150									
HandFinish	Memo	0.00							

Hand Finishing

14-12-4

160	QC7-Inspect Chemical Conversion Coat	0.00							
160									
QC	Memo	0.00							

Quality Control

14-12-4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126869***126869***

Page 4

Thursday, November 27, 2014 11:02:54 AM

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 11/27/2014 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 11/27/2014 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Skidtubes	0.00							
170									
Skidtubes	Memo	0.00							
Skidtubes	1- Bond web as per Dwg D4680 & QSI 015 A/R 241 Sike Flex Batch: <u>129172</u> Exp Date: <u>14-12-30</u> start time: <u>11AM</u> end time: _____								
	2- Seal all faying surfaces using proseal and rivet Doubler as per Dwg D4680. A/R Proseal Batch: <u>130090</u> exp date: <u>15-1-30</u> ***LET IT CURE FOR 7HRS*** START TIME: <u>1130AM</u> FINISH TIME: _____								
	3- Rivet doublers as per dwg								
	4- Open and chamfer holes on section G-G as per dwg. Blowout chips.								
	5- Weld spacers into place as per section G-G ***BACK DRILL*** A/R ALUM. WELDING ROD: <u>M3037</u> and grind flush.								
	6- Ream holes section C-C as per dwg, deburr 8 places								
	7- Swage x-bolt spacers as per Dwg D4680 and section I C-C 8 places.								
	8- Trim/Grind flush per QSI 002								

14-12-9

78E14-12-10

14-12-15

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

DQA:

Date: 15/08/02



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 15/09/02

Work Order update only ☐

Work Order: 126869	DISPOSITION Rework ☒ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS			
Part No. D4680-041		Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☒
NCR No. 15-5297		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐
		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐
		Large Fab ☐	Composite ☐	Supplier ☐	

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design				tube was used for testing. Tube has some minor scratch from handling.		buff out scratch and re-align as per QSI005		DAS 9 9-89	DAS 9 9-89
Doc/Data									
Equip/Tooling									
Handling/Pre	15-03-24	210	①		15/08/02		15-08-02	15-03-24	15-03-24
Material									
Operator									
Offset/Setup									
Process				P.C. tube was use for testing.	15-02-02				
Supplier									
Training									
Transport				tube was made as per rev C but is now correct rev D					
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☒ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	---	---	--	--

126869

Page 6

N900040100

Setup Start *NS1*

Stop *NS2*

Start Date: 11/27/2014 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 11/27/2014 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Run	Start	*NR1*
	Stop	*NR2*

Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
---------	--------	-----------	------------	------------	---------------	-------------

White Gloss(Ref:4.3.5.1),per QSI005 4.3-Alum

220

Powdercoat

Powder Coating

Memo

START TIME:

OVEN TEMPERATURE:

FINISH TIME:

230

QC3- Inspect Part Finish

230

QC

Quality Control

000 34 SVD

**DAS
15
9-89**

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design ☐									
Doc/Data ☐									
Equip/Tooling ☐									
Handling/Pre ☐									
Material ☐									
Operator ☐									
Offset/Setup ☐									
Process ☐									
Supplier ☐									
Training ☐									
Transport ☐									
Unapproved ☐									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Work Order ID 126869

Thursday, November 27, 2014 11:02:54 AM

126869

Page 7

Item ID: D4680-041 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: Skidtube Assembly
Start Date: 11/27/2014 Start Qty: 1.00 *1* Cust Item ID:
Required Date: 11/27/2014 Req'd Qty: 1.00 *1* Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
260	HandFinishing	0.00							
260	HandFinish	0.00							
Hand Finishing	Memo								
	1- Install Wearplate & Ground Wire inserts as per Dwg D4680.								
	2-Inspect for Foreign objects								
	3- Install Fwd & Aft caps as per Dwg D4680 and Detail "A" & "B"								
	A/R 241 Sika Flex Batch: <u>11132392</u>								
	Exp Date: <u>16102</u>								
	4- Assemble o'ring to plug as per dwg D3492-055 and apply o'ring lube								
	A/R 55-o'ring lube batch: <u>11131349</u> RTU 598 11132017 exp 15/07								
	5- Wing Walk as per Dwg D4680 and QSI 005 4.4								
	Batch: <u>11132599</u>								
270	QC5- Inspect part completeness to step on W/O	0.00							
270	QC	0.00							
Quality Control	Memo								

JUN 29 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge		
☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other		

Thursday, November 27, 2014 11:02:54 AM

1 26869

Page 8

Accept

N900040100

Setup Start *NS1*

Revision ID:

Item Name: Skidtube Assembly

Stop *NS2*

Start Date: 11/27/2014 **Start Qty:** 1.00

*** 1 ***

Cust Item ID:

Required Date: 11/27/2014 **Req'd Qty:** 1.00

*** 1 ***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

```
Run      Start *NR1*
          Stop  *NR2*
```

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID	Tool #	Plan Code
---------	--------	-----------

Accept Qty	Reject Qty	Reject Number	Insp. Stamp

300

Identify as per dwg & Stock Location:

0.00

300

Packaging

0.00

Packaging

Memo

Packaging

310

QC21- Final Inspection - Work Order Release

0.00

310

Memo

0.00

QC

Memo

Quality Control

mc5 AUG 18 2015

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear	General		
☐ Bending	☐ Bend	☐ Folio/Program	☐ Outside Dimensions
☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance
☐ Cracks	☐ Broken/Damage/Defect	☐ Hardware	☐ Part Incorrect
☐ Crimp/Kink/Ripple/Wave	☐ Burrs	☐ Inspection Incomplete/Unqualified	☐ Part Lost/Missing
☐ Cuffs	☐ Contamination	☐ Instructions Incomplete/Unclear	☐ Part Moved
☐ Crushing	☐ Countersink	☐ Misaligned/off center	☐ Positioned Wrong
☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Power Loss/Surge
☐ Inspection Strip in Tube	☐ Drawing	☐ Misread	☐ Pressure/Forced
☐ Marks/Chatter	☐ Drill Holes	☐ Off-set	☐ Set-up
☐ Turning Sequence	☐ Finish	☐ Out of Calibration	☐ Temperature/Cure
☐ Wave/Twist in Tube	☐ Fit/Function	☐ Out of Sequence	☐ Weld
			☐ Wrong Stock Pulled
			☐ Other

Picklist Print

Thursday, November 27, 2014 11:02:57 AM

Page 1

Work Order ID: 126869

126869

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 11/27/2014

Required Date: 11/27/2014

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.04.16 NEW ISSUE DD VERF:JLM IPP
REV:B 13.08.08 PB2 DD VERF:JLM IPP REV:C
13.09.10 PB3 DD VERF:JLM IPP REV:D 13.11.14
AS PER DWG REV.B DD VERF:JLM IPP REV:C 14.11.24 AS PER
DWG REV.C DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

AN526C1032R10

Purchased

No

Each

87.0000

2

AN526C1032R10

Screw

**

11/06/21

Location

Loc Qty

Loc Code

FP001

6

108062

6

ST327

81

m128712

81

Each

93.0000

2

D2973

Manufactured

No

D2973

Cross Bolt Spacer

**

11/06/21

Location

Loc Qty

Loc Code

LG001

93

107428

38

123939

55

Each

45.0000

4

D3492-15

Manufactured

No

D3492-15

Plug

* D3492-055 / 13109041

(x4)

**

11/06/21

Location

Loc Qty

Loc Code

FP001

45

115874

20

122459

25

REF (D3492-055)

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Thursday, November 27, 2014 11:02:57 AM

Page 2

Work Order ID: 126869

126869

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 11/27/2014

Required Date: 11/27/2014

Start Qty: 1.00

Required Qty: 1.00

NAS1611-015

Purchased No

Each 52.0000

4

NAS1611-015

O-RING

**

15/06/24

Location

Loc Qty

Loc Code

FP001

52

m126637

52

X4

REF (D3492-055)

D2962-150

Manufactured No

Each 30.0000

**

14-12-1

D2962-150

3.540 Outer Tube, Extrut

Location

Loc Qty

Loc Code

HALL

30

90871

30

Each

0.0000

**

14-12-9

D4681-041

Manufactured No

D4681-041

Web Assembly

D4686-1

Manufactured No

Each 90.0000

**

14-12-15

D4686-1

Spacer

Location

Loc Qty

Loc Code

LG001

90

107104

86

97772

4

Each

44.0000

**

14-12-9

D4753-1

Manufactured No

D4753-1

Doubler

Location

Loc Qty

Loc Code

LG001

44

122305

44

14-12-9

Thursday, November 27, 2014 11:02:57 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design ☐									
Doc/Data ☐									
Equip/Tooling ☐									
Handling/Pre ☐									
Material ☐									
Operator ☐									
Offset/Setup ☐									
Process ☐									
Supplier ☐									
Training ☐									
Transport ☐									
Unapproved ☐									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence
		☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge
		☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other

Picklist Print

Thursday, November 27, 2014 11:02:57 AM

Page 3

Work Order ID: 126869

126869

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 11/27/2014

Required Date: 11/27/2014

Start Qty: 1.00

Required Qty: 1.00

AELS-1032-130

AELS8-1032-130 Purchased

No

Each

91.0000

AFI S-1032-130

Rivnut

ANS4-1032-130 / 11132312

(x3)

3

all

islog 21

Location

Loc Qty

Loc Code

ST280

91

m128179

91

Each

1,073.000

3

all

islog 21

AN3C4A

Purchased

No

AN3C4A

Bolt

Location

Loc Qty

Loc Code

FG

20

122814

20

11132189

x3

ST350

1053

124221

12

M127410

1

M127832

62

M128606

32

M128634

8

M128739

4

M128879

71

M129520

61

M130716

802

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Thursday, November 27, 2014 11:02:57 AM

Page 4

Work Order ID: 126869

126869

Parent Item: D4680-041

D4680-041

Parent Item Name: Skidtube Assembly

Start Date: 11/27/2014

Required Date: 11/27/2014

Start Qty: 1.00

Required Qty: 1.00

NAS1149F0332P

Purchased

No

Each

2,668.000

5

NAS1149F0332P

Washer

**

11/10/12

NAS1149C0332R pr 15.55 MF 15-6-24

Location

Loc Qty

Loc Code

ST260a

2000

11132262

13

m130325

2000

st268

668

122063

205

123900

10

125646

106

m127831

347

Each

340.0000

32

MS20601-AD4W3

Purchased

No

MS20601-AD4W3

Rivet

**

14-12-9

Location

Loc Qty

Loc Code

LG001

20

124365

20

ST308

320

114538

228

124331

92

Each

13.0000

1

D2965

Manufactured

No

D2965

Cap

**

11/10/12

Location

Loc Qty

Loc Code

FP001

13

13127852

11

126580

2

99551

11

Thursday, November 27, 2014 11:02:57 AM

Shop Packet Print

Page 4

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									

FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge ☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--

Picklist Print

Thursday, November 27, 2014 11:02:57 AM

Page 5

Work Order ID: 126869

Parent Item: D4680-041

Parent Item Name: Skidtube Assembly

126869

D4680-041

Start Date: 11/27/2014

Required Date: 11/27/2014

Start Qty: 1.00

Required Qty: 1.00

AN3C5A

Purchased

No

Each

2,020.000

2

AN3C5A

Bolt

**

all v3l0c12a

Location

Loc Qty

Loc Code

FG

5

11131803

x2

122800

5

ST338a

1932

M130770

1000

M130851

932

ST350

83

M128911

25

M128973

10

M129913

4

M130358

44

D2965-3

Manufactured

No

Each

14.0000

1

D2965-3

Cap

**

all v3l0c12a

Location

Loc Qty

Loc Code

FP001

14

13126369

x1

120969

7

98923

7

Thursday, November 27, 2014 11:02:57 AM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width: 100%;"> <tr> <td>Skid-tube ☐</td> <td>Crosstube ☐</td> <td>Water Jet ☐</td> <td>Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>	Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Crosstube ☐	Water Jet ☐	Engineering ☐															
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐															
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐															
Large Fab ☐	Composite ☐	Supplier ☐																

Root Cause	Date	Step	Qty	Description of work order update or non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Design									
Doc/Data									
Equip/Tooling									
Handling/Pre									
Material									
Operator									
Offset/Setup									
Process									
Supplier									
Training									
Transport									
Unapproved									


FAULT CATEGORY

Landing Gear ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Inspection Strip in Tube ☐ Marks/Chatter ☐ Turning Sequence ☐ Wave/Twist in Tube	General ☐ Bend ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Burrs ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Drawing ☐ Drill Holes ☐ Finish ☐ Fit/Function	☐ Folio/Program ☐ Grain ☐ Hardware ☐ Inspection Incomplete/Unqualified ☐ Instructions Incomplete/Unclear ☐ Misaligned/off center ☐ Mislabeled ☐ Misread ☐ Off-set ☐ Out of Calibration ☐ Out of Sequence	☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Positioned Wrong ☐ Power Loss/Surge	☐ Pressure/Forced ☐ Set-up ☐ Temperature/Cure ☐ Weld ☐ Wrong Stock Pulled ☐ Other
--	--	---	--	--


ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	4	D3492-055	PLUG ASSY
4	1	D4680-043	SKIDTUBE SUB ASSY
5	2	AN3C5A	BOLT
6	2	AN526C1032R10	SCREW
7	2	NAS1149F0332P	WASHER (AN960-10L)

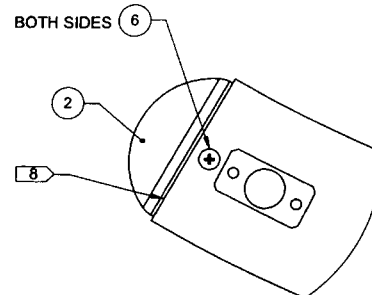

DETAIL A
SCALE 4X

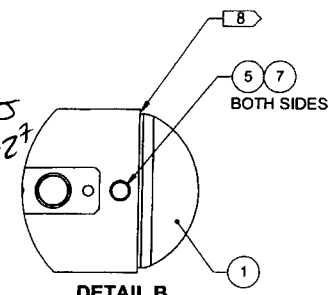

DETAIL B
SCALE 4X

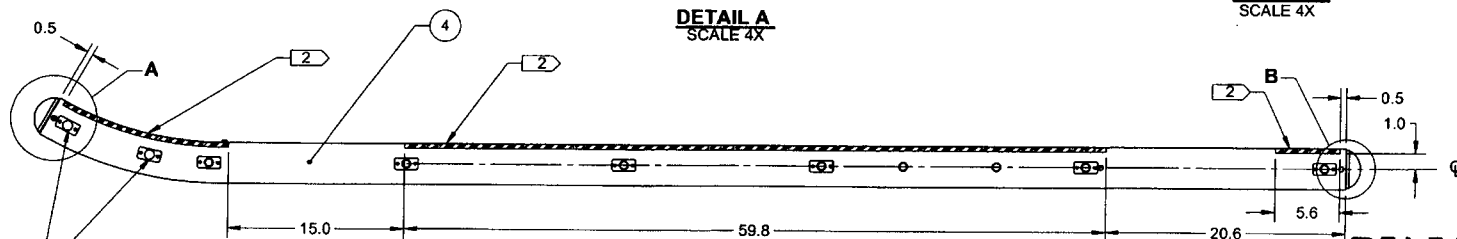

D4680-041 SKIDTUBE

INSTALL D3492-055 PLUG ASSY
AFTER SWAGING
(BOTH SIDES)

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 18.56 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 126869 MLJ
14-11-27

RELEASED
2014-11-20
mf

C	NAS1149F0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3, VARIOUS DIMENSIONAL CHANGES D3492-055 PLUG ASSY WAS D3492-051, SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2), ADDED DETAIL H (C2-3), MATERIAL D2962-150 WAS D2962-131 (A7-3), GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA DRAWING NO. D4680 TITLE SKIDTUBE SCALE NTS COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	
DRAWN	AP		
CHECKED	ML		
MFG. APPR.	JLM		
APPROVED	MP		
DE APPR.	DS		
DATE	14.07.29	REV. C SHEET 1 OF 3	

APPROVED


ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	2	D2973	SPACER
2	1	D4680-1	SKIDTUBE
3	1	D4681-041	WEB ASSY
4	8	D4686-1	SPACER
5	16	D4753-1	DOUBLER
6	3	AELS-1032-130	INSERT
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149F0332P	WASHER (AN960-10L)

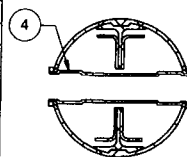

SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D



1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000 \times 1.0$ DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

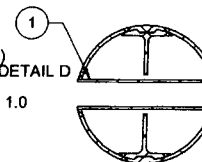

SECTION G-G
SCALE 4X
2 PL


INSTALL D2973 SPACER AS FOLLOWS (2 PL)

1. CHAMFER HOLE 0.030×45 DEG
2. INSERT D2973 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS $\phi 0.625$ DRILL TO REMOVE SPILL OVER

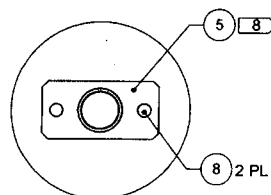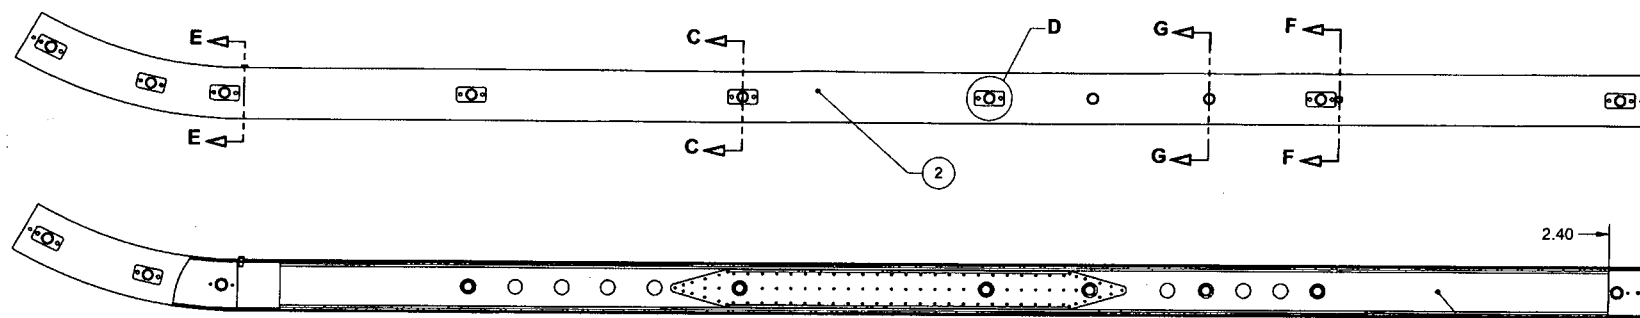


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

D4680-043 SKIDTUBE SUB ASSY

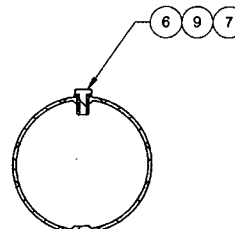

SECTION E-E
SCALE 2.5X

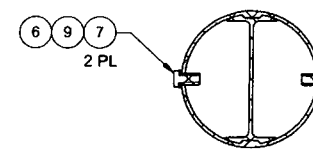

SECTION F-F
SCALE 2.5X

- NOTES:**
- 1) MATERIAL: N/A
 - 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB. POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: N/A
 - 6) IDENTIFICATION: NONE
 - 7) WEIGHT: 17.91 lbs
 - 8) SEAL ALL MATING SURFACES USING PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
 - 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
 - 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
 - 11) WELDING: PER QSI 004

APPROVED


DESIGN	AP
DRAWN	AP
CHECKED	ML
MFG. APPR.	JLM
APPROVED	MP
DE APPR.	DS
DATE	14.07.29

DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.	REV. C
D4680	SHEET 2 OF 3
TITLE	SCALE
SKIDTUBE	NTS

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


RELEASED
2014-11-20

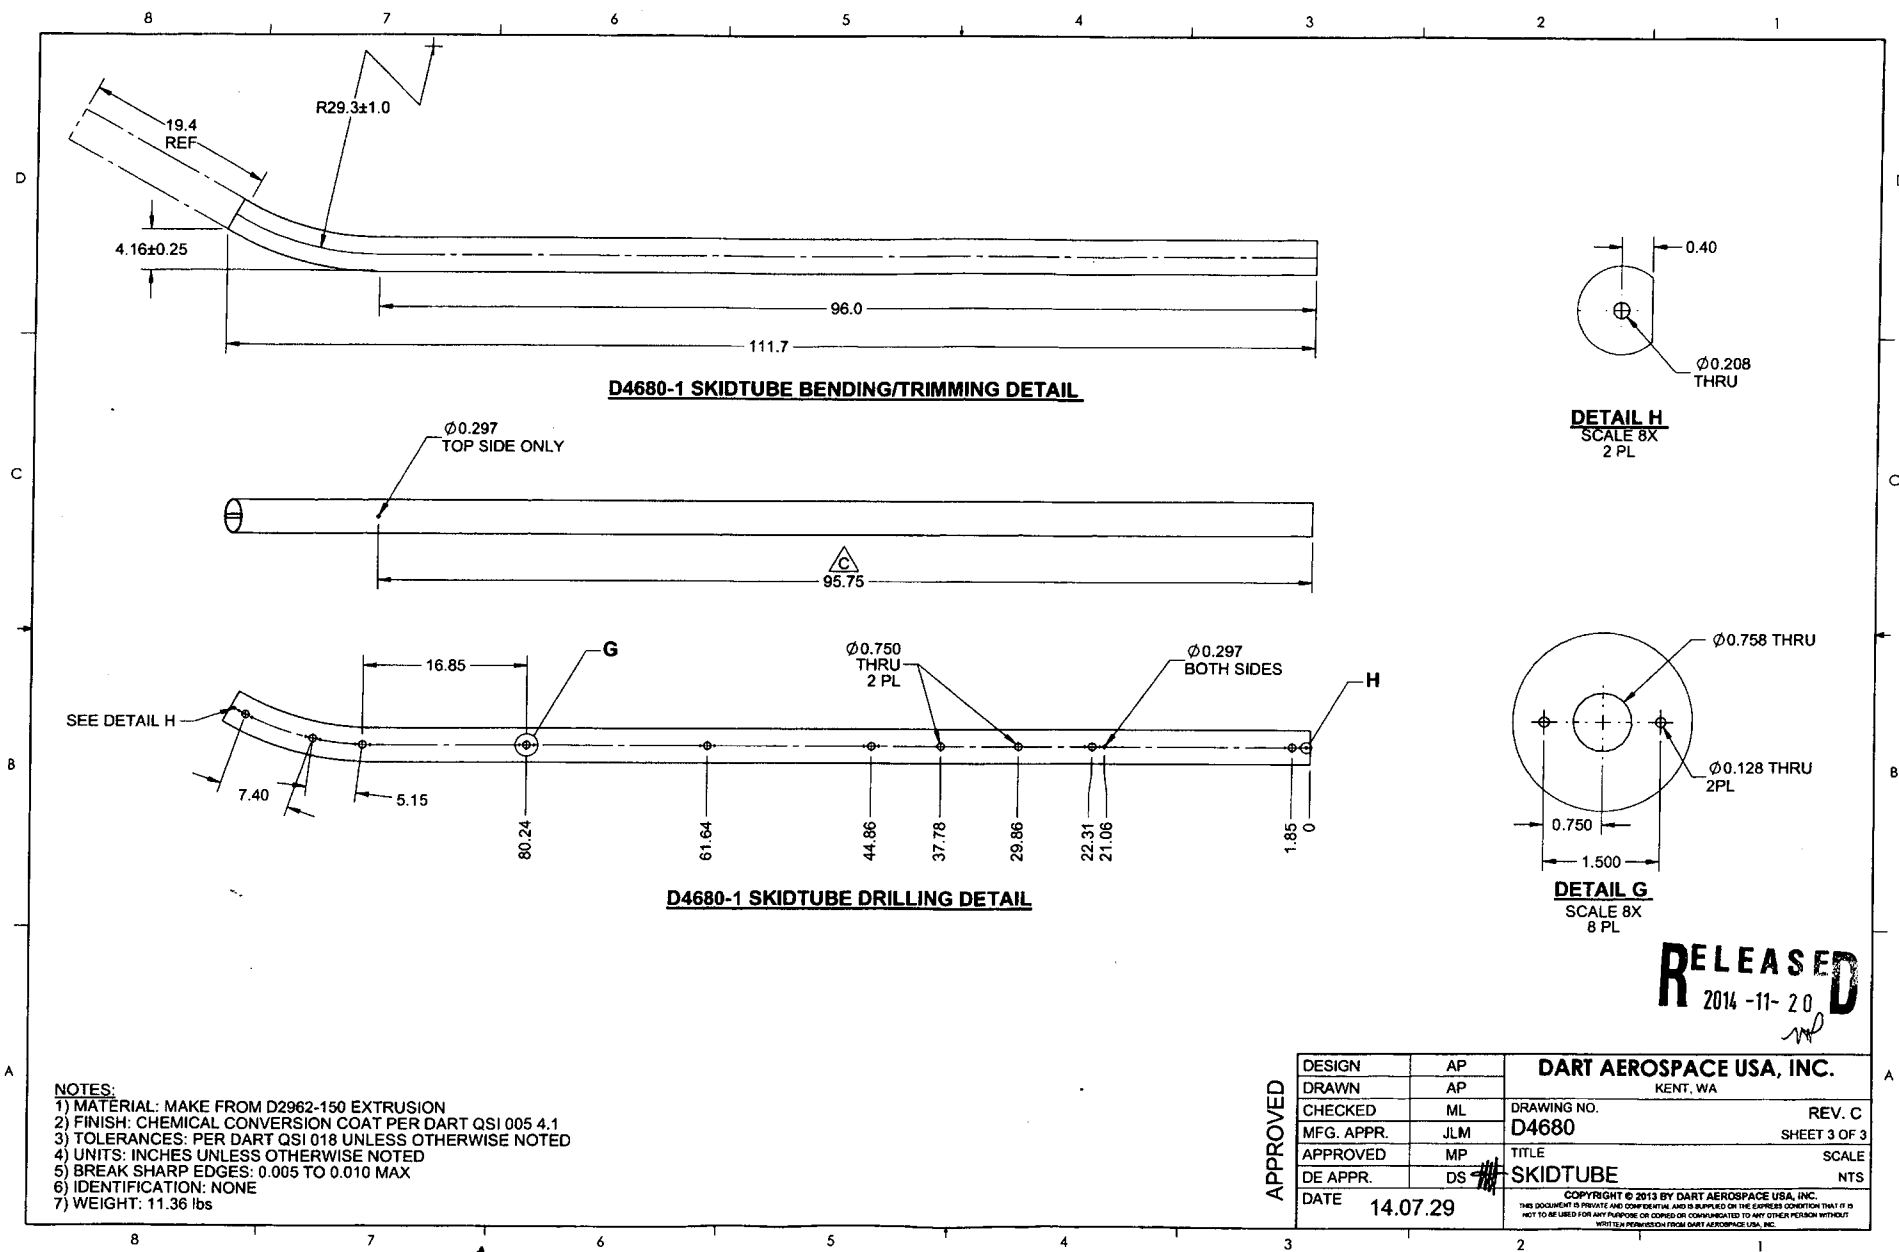

RELEASED
2014-11-20

D3492-XX PLUG
(SEE TABLE)

NAS1611 O-RING
(SEE TABLE)

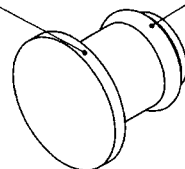

D3492-XXX PLUG PARTS LIST


QTY -041	QTY -043	QTY -045	QTY -047	QTY -049	QTY -051	QTY -053	QTY -055	PART NUMBER	DESCRIPTION
X								D3492-041	PLUG ASSEMBLY
	X							D3492-043	PLUG ASSEMBLY
		X						D3492-045	PLUG ASSEMBLY
			X					D3492-047	PLUG ASSEMBLY
				X				D3492-049	PLUG ASSEMBLY
					X			D3492-051	PLUG ASSEMBLY
						X		D3492-053	PLUG ASSEMBLY
							X	D3492-055	PLUG ASSEMBLY
1								D3492-1	PLUG
	1							D3492-3	PLUG
		1						D3492-5	PLUG
			1					D3492-7	PLUG
				1				D3492-9	PLUG
					1			D3492-11	PLUG
						1		D3492-13	PLUG
							1	D3492-15	PLUG
		1						NAS1611-005	O-RING
			1					NAS1611-007	O-RING
1								NAS1611-010	O-RING
	1						1	NAS1611-012	O-RING
								NAS1611-013	O-RING
				1			1	NAS1611-015	O-RING
				1				NAS1611-016	O-RING

NOTES:



1) O-RING: POSSIBLE SUPPLIER P/N: NAS1611-XXX OR PARKER 2-XXX

RELEASED
2013-11-13

E	ADD -055 PLUG ASSY & -15 PLUG	AP	13.08.08
D	INCORPORATED DEO D3492-C-1. SHT 2 DIM C FOR -1 WAS 0.055. (SEE CAR11-048)	AJS	11.05.24
C	ADD -049/-051/-053. CHANGE DRAWING FORMAT	PH	07.10.05
B	ADD -047: UPDATE DIM A FOR -045	PH	06.05.11
A	NEW ISSUE	PH	06.01.04
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AP		
CHECKED	AJS	DRAWING NO.	REV. E
MFG. APPR.	14	D3492	SHEET 1 OF 2
APPROVED	14	TITLE	SCALE
DE APPR.	14	PLUG	NTS
DATE	13.08.08	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESSED CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

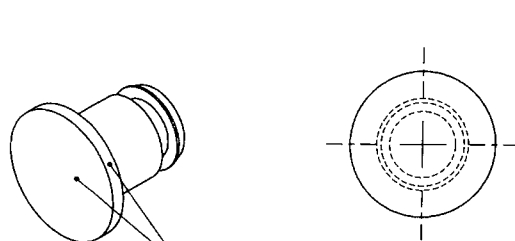

POWDER COAT THESE
FACES ONLY PER NOTE 2

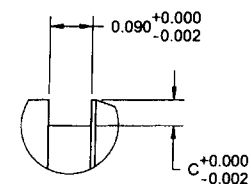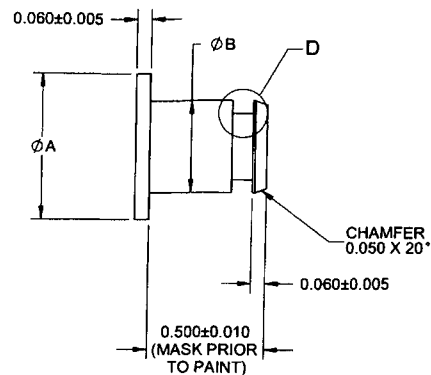

DETAIL D

D3492-XX PLUG

D3492-XX PLUG MACHINING DETAILS


P/N	A	B	C	MATERIAL SPEC
D3492-1	0.625	0.394	0.050	M6061T6R0.625
D3492-3	0.750	0.582	0.045	M6061T6R0.750
D3492-5	0.375	0.188	0.045	M6061T6R0.375
D3492-7	0.500	0.270	0.045	M6061T6R0.500
D3492-9	0.938	0.750	0.045	M6061T6R1.000
D3492-11	0.850	0.664	0.045	M6061T6R0.875
D3492-13	0.750	0.510	0.045	M6061T6R0.750
D3492-15	0.850	0.640	0.050	M6061T6R0.875

NOTES:


- 1) MATERIAL: ALUMINUM 5052-H32 OR 6061-T6 OR 1100-0 PER QQ-A-225/7 (5052) OR QQ-A-225/8 (6061) OR QQ-A-200/8 (6061) OR QQ-A-225/1 (1100) (REF. DART MATERIAL SPEC M6061T6R0.000)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE GLOSS (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: N/A

DESIGN	PH	DART AEROSPACE LTD	
DRAWN	AP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ALS	DRAWING NO.	REV. E
MFG. APPR.	DS	D3492	SHEET 2 OF 2
APPROVED	AP	TITLE	SCALE
DE APPR.	AP	PLUG	4:1
DATE	13.08.08	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
2013-11-13

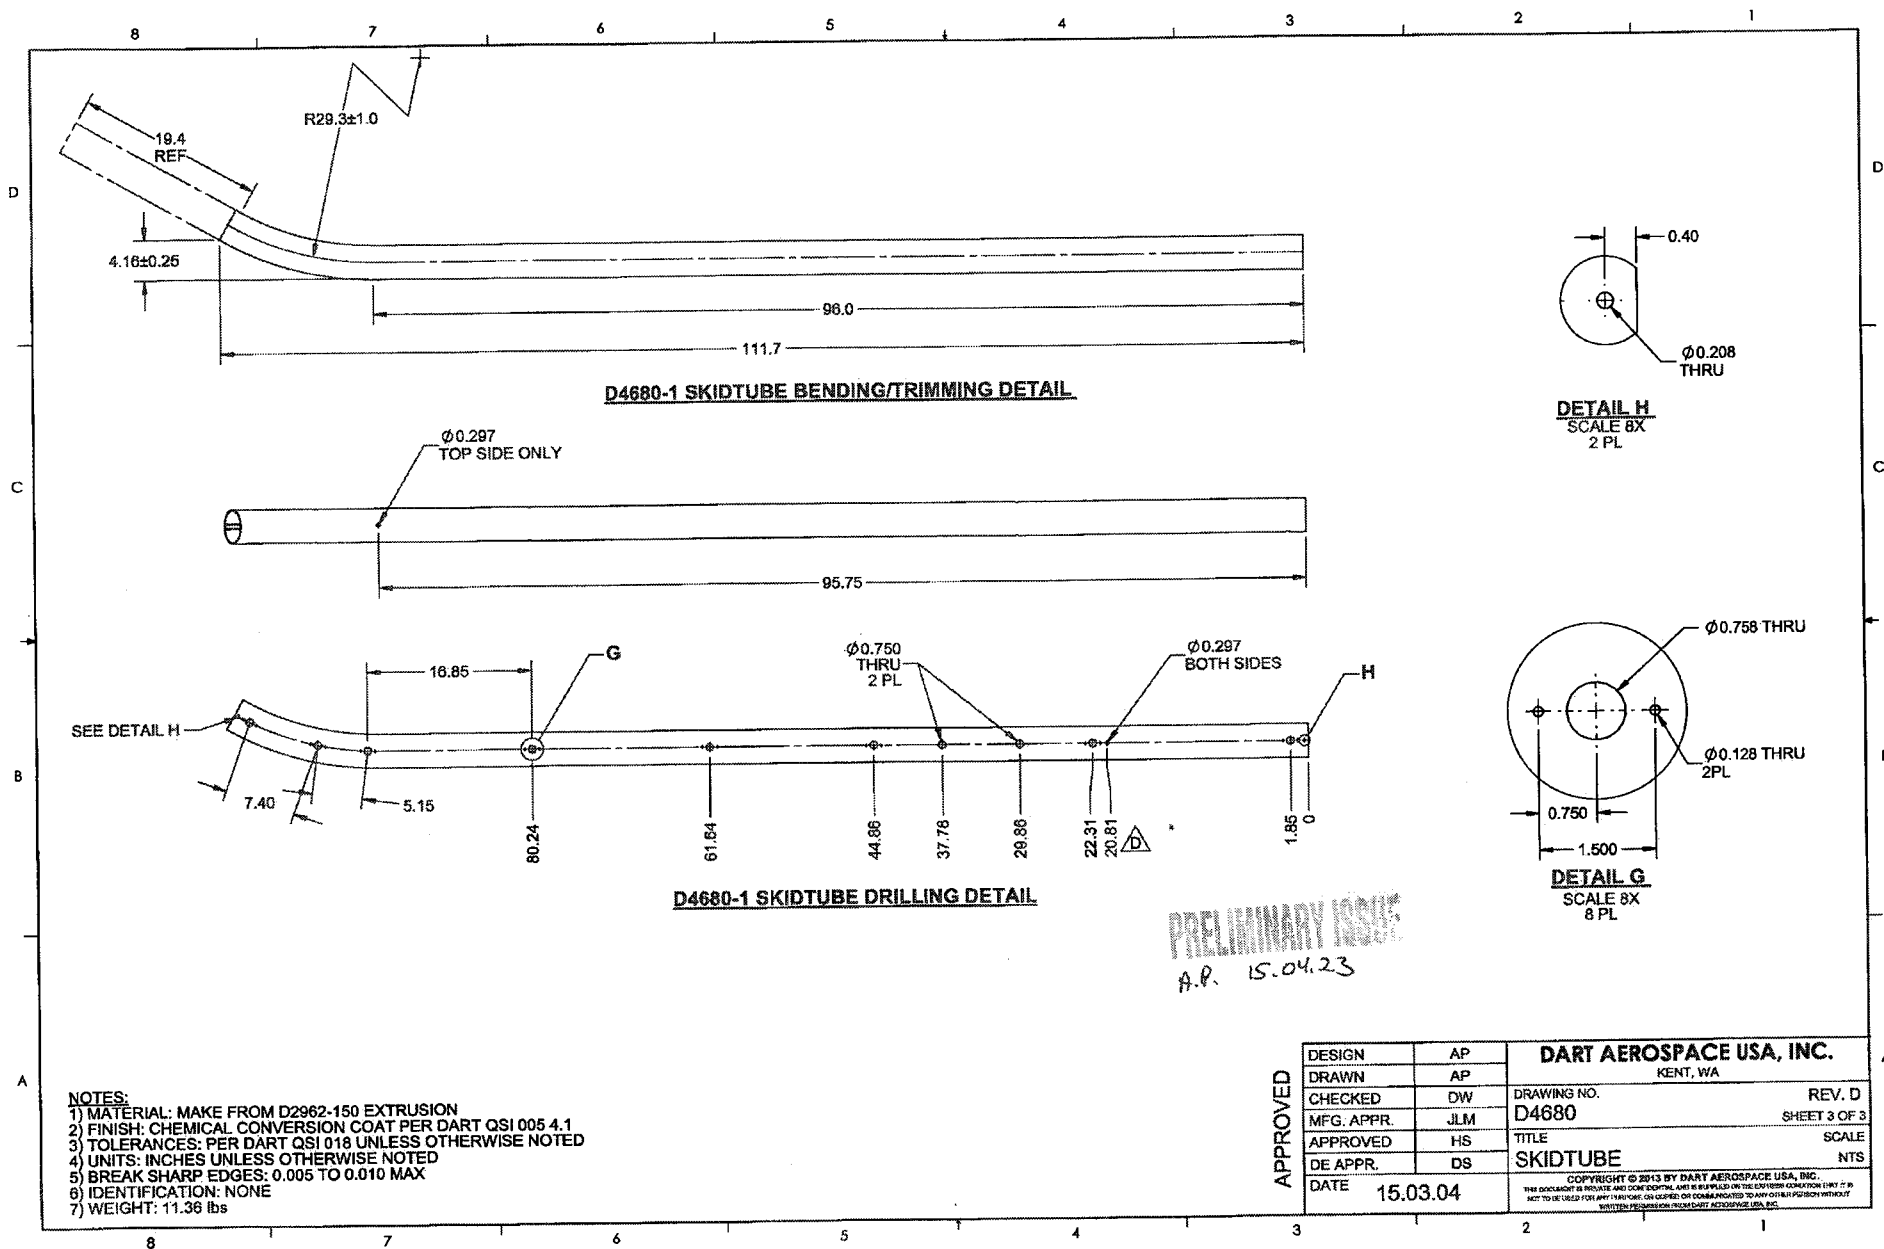

ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	4	D3492-055	PLUG ASSY
4	1	D4680-043	SKIDTUBE SUB ASSY
5	2	AN3CSA	BOLT
6	2	AN526C1032R10	SCREW
7	2	NAS1149C0332R	WASHER (AN960-10L)

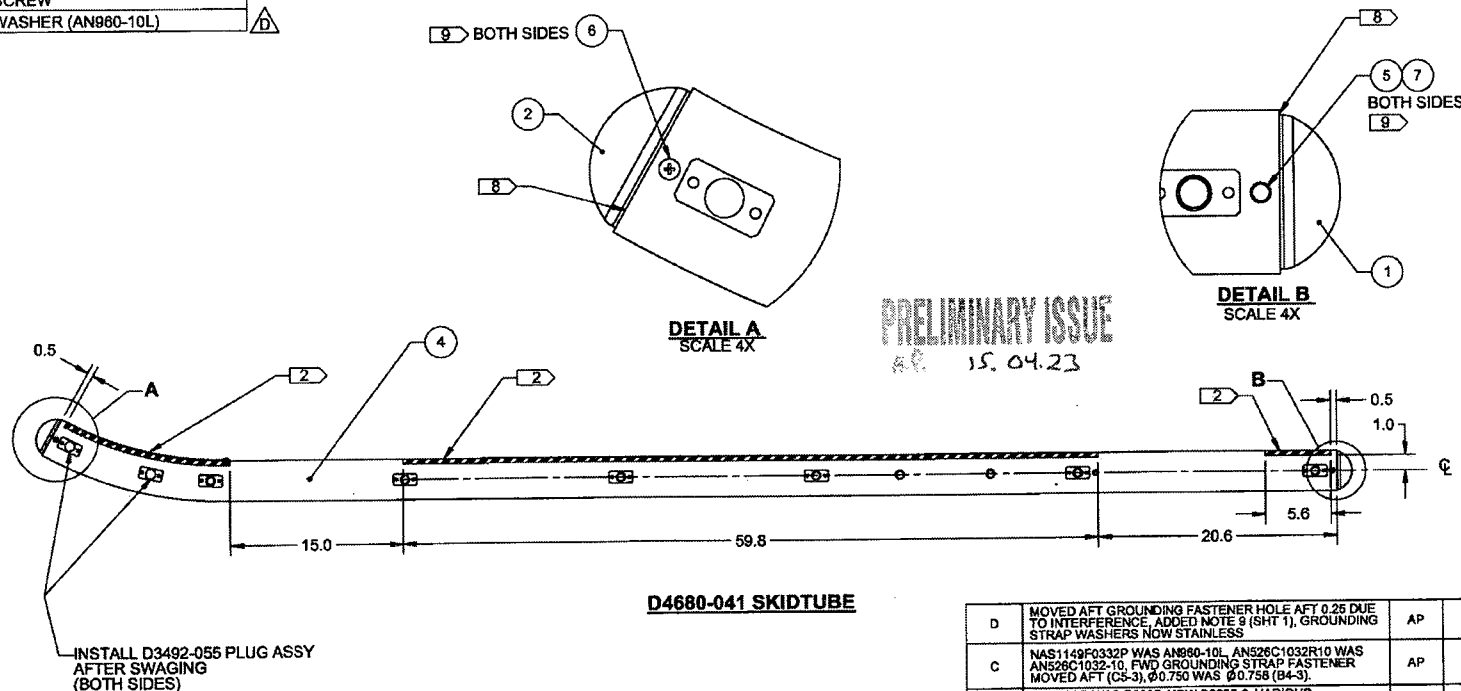

D4680-041 SKIDTUBE

NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 18.66 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT

D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE. ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149C0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3, VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051, SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2), ADDED DETAIL H (C2-3), MATERIAL D2862-150 WAS D2862-131 (A7-3), GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.08.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	DW		
MFG. APPR.	JLM		
APPROVED	HS		
DE APPR.	DS	TITLE SKIDTUBE	
DATE	15.03.04	SCALE NTS	

APPROVED

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS REPRODUCED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	2	D2973	SPACER
2	1	D4680-1	SKIDTUBE
3	1	D4681-041	WEB ASSY
4	8	D4686-1	SPACER
5	16	D4753-1	DOUBLER
6	3	AELS-1032-130	INSERT
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER (AN960-10L)

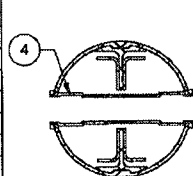

SECTION C-C 10
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D



1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.850 \pm 0.010/-0.000 \times 1.0$
DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

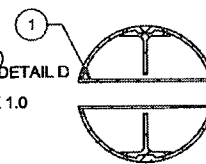

SECTION G-G 11
SCALE 4X
2 PL


INSTALL D2973 SPACER AS FOLLOWS (2 PL)

1. CHAMFER HOLE 0.030X45 DEG
2. INSERT D2973 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS $\phi 0.625$ DRILL TO REMOVE SPILL OVER

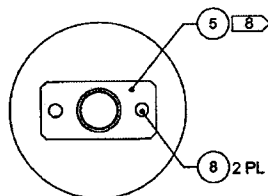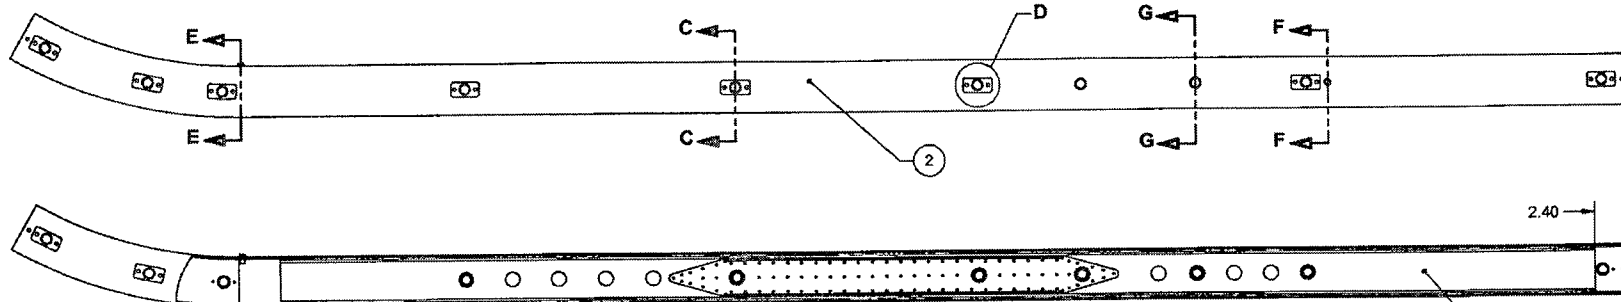


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

D4680-043 SKIDTUBE SUB ASSY

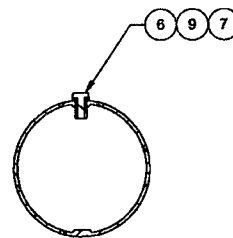

SECTION E-E
SCALE 2.5X

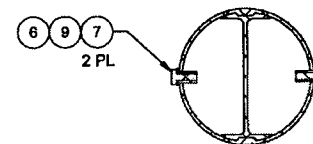

SECTION F-F
SCALE 2.5X

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB.
POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: 17.91 lbs
- 8) SEAL ALL MATING SURFACES USING PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND
WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
- 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
- 11) WELDING: PER QSI 004

APPROVED


DESIGN	AP
DRAWN	AP
CHECKED	DW
MFG. APPR.	JLM
APPROVED	HS
DE APPR.	DS
DATE	15.03.04

DART AEROSPACE USA, INC.
KENT, WA

DRAWING NO.	REV. D
D4680	SHEET 2 OF 3
TITLE	SCALE
SKIDTUBE	NTS

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

ITEM	QTY -041	P/N	DESCRIPTION
	X	D4680-041	SKIDTUBE
1	1	D2965	CAP
2	1	D2965-3	CAP
3	4	D3492-055	PLUG ASSY
4	1	D4680-043	SKIDTUBE SUB ASSY
5	2	AN3C5A	BOLT
6	2	AN526C1032R10	SCREW
7	2	NAS1149C0332R	WASHER (AN960-10L)

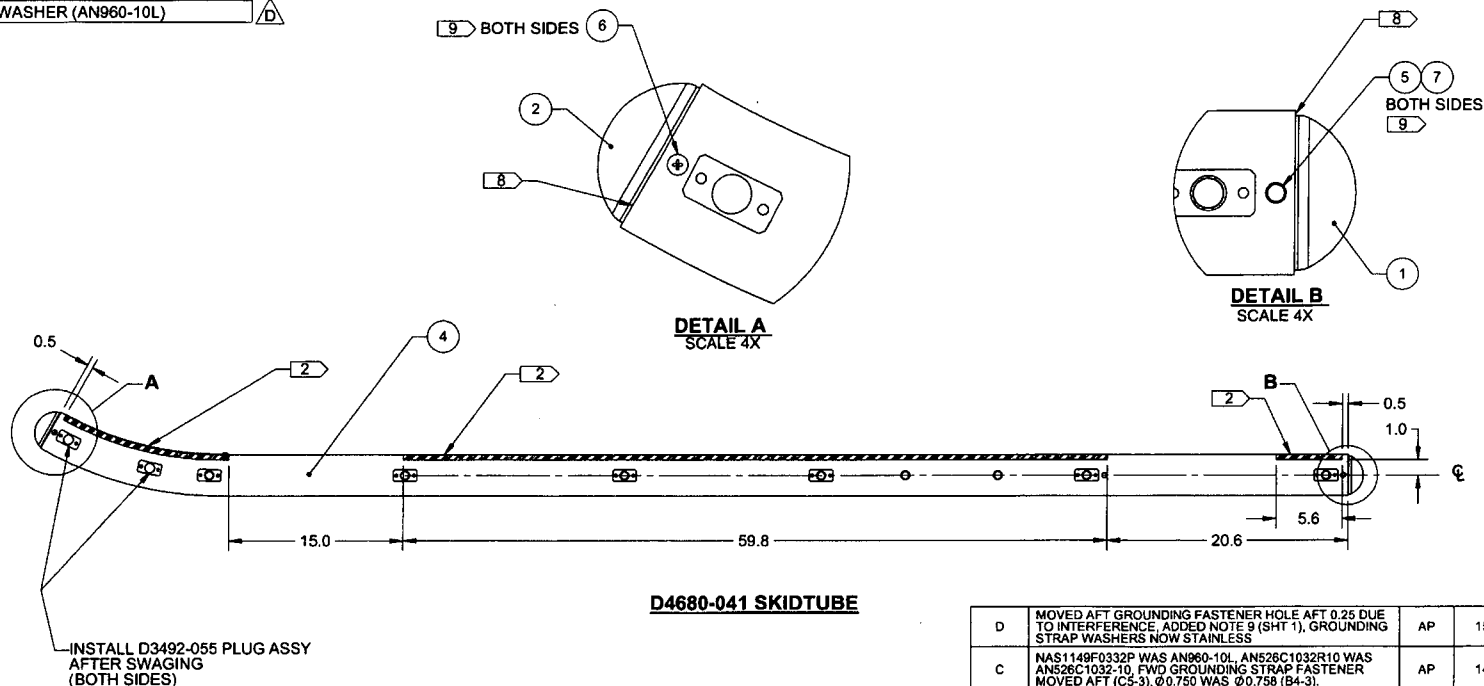

D4680-041 SKIDTUBE

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 1.00 ABOVE CENTERLINE PER QSI 005 SECTION 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D4680-041" AND B/N PER QSI 044 METHOD 6.4 ON INNER RADIUS OF SKIDTUBE BEFORE INSTALLING D2965 CAP
- 7) WEIGHT: 18.56 lbs
- 8) SEAL FAYING SURFACES WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT
- 9) INSTALL FASTENERS WET WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B-2 SEALANT

D	MOVED AFT GROUNDING FASTENER HOLE AFT 0.25 DUE TO INTERFERENCE. ADDED NOTE 9 (SHT 1), GROUNDING STRAP WASHERS NOW STAINLESS	AP	15.03.04
C	NAS1149F0332P WAS AN960-10L, AN526C1032R10 WAS AN526C1032-10, FWD GROUNDING STRAP FASTENER MOVED AFT (C5-3), Ø0.750 WAS Ø0.758 (B4-3).	AP	14.07.29
B	FWD CAP WAS D2965 NOW D2965-3, VARIOUS DIMENSIONAL CHANGES. D3492-055 PLUG ASSY WAS D3492-051. SWAGING DIMENSION NOW 0.650 WAS 0.661 (D6-2). ADDED DETAIL H (C2-3). MATERIAL D2962-150 WAS D2962-131 (A7-3). GROUND HANDLING THRU HOLES NOW WELDED, ADDED SECTION G-G (D3-2)	AP	13.09.10
A	NEW ISSUE	AP	13.02.13
REV.	DESCRIPTION	BY	DATE
DESIGN	AP	DART AEROSPACE USA, INC. KENT, WA	
DRAWN	AP		
CHECKED	DW	DRAWING NO. D4680	
MFG. APPR.	JLM	REV. D	
APPROVED	HS	SHEET 1 OF 3	
DE APPR.	DS	TITLE SKIDTUBE	
DATE	15.03.04	SCALE NTS	

RELEASED
2015-06-08
EWN 15-551

APPROVED

COPYRIGHT © 2013 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR DISSEMINATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
							Lead hand / Supervisor Approval Verification																		
							QC / QA Coordinator Approval																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

ITEM	QTY	P/N	DESCRIPTION
	X	D4680-043	SKIDTUBE SUB ASSY
1	2	D2973	SPACER
2	1	D4680-1	SKIDTUBE
3	1	D4681-041	WEB ASSY
4	8	D4686-1	SPACER
5	16	D4753-1	DOUBLER
6	3	AELS-1032-130	INSERT
7	3	AN3C4A	BOLT
8	32	MS20601AD4W3	RIVET, BLIND, CSK
9	3	NAS1149C0332R	WASHER (AN960-10L)

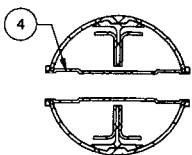


SECTION C-C
SCALE 4X
8 PL

INSTALL D4686-1 SPACER AS FOLLOWS (8 PL)
AFTER INSTALLING D4753-1 DOUBLERS PER DETAIL D

1. INSERT D4686-1 SPACER
2. SWAGE TO $\phi 0.650 +0.010/-0.000 \times 1.0$
3. DEEP PER QSI 002



TRIM/GRIND FLUSH PER QSI 002

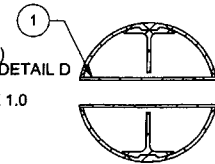

SECTION G-G
SCALE 4X
2 PL


INSTALL D2973 SPACER AS FOLLOWS (2 PL)

1. CHAMFER HOLE 0.030X45 DEG
2. INSERT D2973 SPACER
3. WELD INTO PLACE AND GRIND FLUSH
4. PASS $\phi 0.625$ DRILL TO REMOVE SPILL OVER

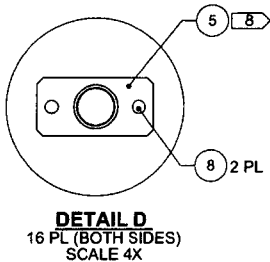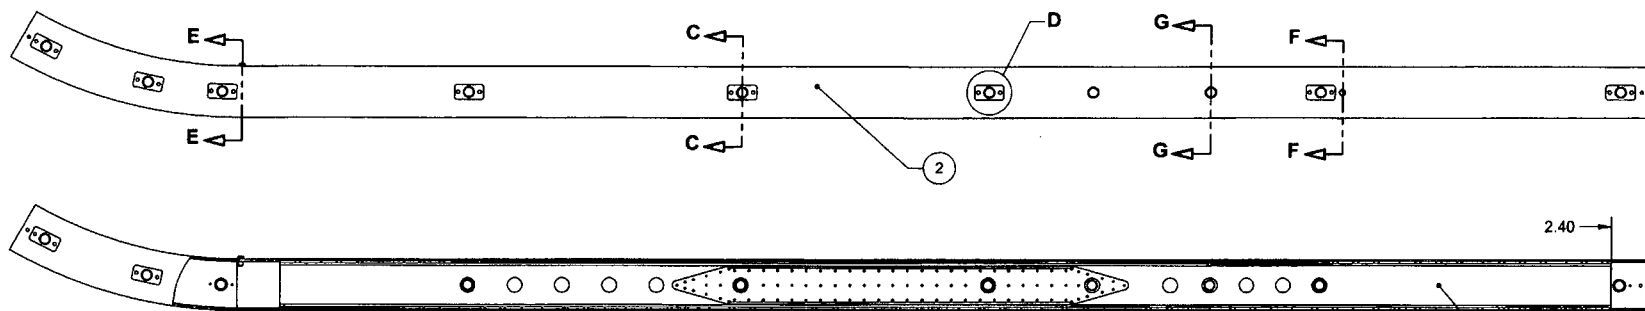


DETAIL D
16 PL (BOTH SIDES)
SCALE 4X

D4680-043 SKIDTUBE SUB ASSY

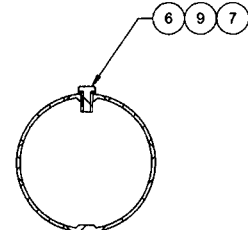

SECTION E-E
SCALE 2.5X

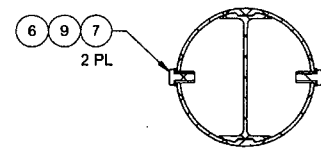

SECTION F-F
SCALE 2.5X

RELEASED
2015-06-08

- NOTES:**
- 1) MATERIAL: N/A
 - 2) FINISH: APPLY CHEMICAL CONVERSION COATING PER DART QSI 005 4.1 PRIOR TO INSTALLING D4681-041 WEB. POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: N/A
 - 6) IDENTIFICATION: NONE
 - 7) WEIGHT: 17.91 lbs
 - 8) SEAL ALL MATING SURFACES USING PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
 - 9) INSERT D4681-041 WEB INTO D4680-1 SKIDTUBE IN LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX -241/-291 ADHESIVE PER DART QSI 015
 - 10) INSTALL D4686-1 SPACER AFTER INSTALLING D4753-1 DOUBLERS
 - 11) WELDING: PER QSI 004

APPROVED

DESIGN	AP
DRAWN	AP
CHECKED	DW
MFG. APPR.	JLM
APPROVED	HS
DE APPR.	DS
DATE	15.03.04

DART AEROSPACE USA, INC. KENT, WA	
DRAWING NO. D4680	REV. D SHEET 2 OF 3
TITLE SKIDTUBE	SCALE NTS
COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL. ANY IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

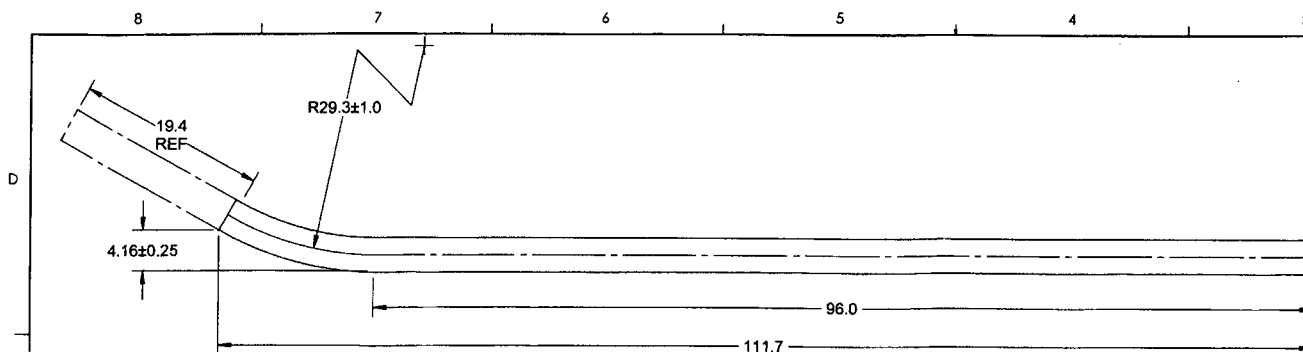


D4680-1 SKIDTUBE BENDING/TRIMMING DETAIL

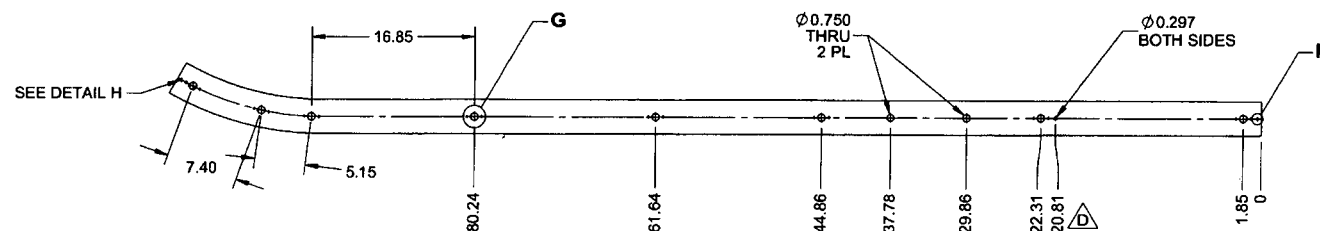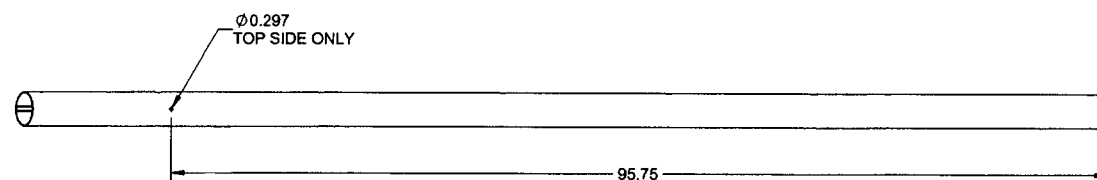

D4680-1 SKIDTUBE DRILLING DETAIL

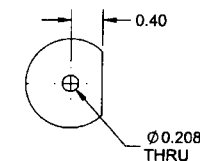

DETAIL H
SCALE 8X
2 PL

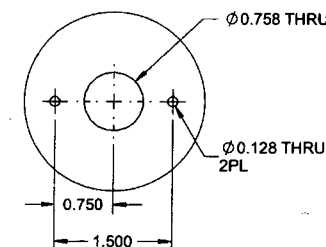

DETAIL G
SCALE 8X
8 PL

RELEASED
2015-06-08

- NOTES:**
- 1) MATERIAL: MAKE FROM D2962-150 EXTRUSION
 - 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
 - 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
 - 4) UNITS: INCHES UNLESS OTHERWISE NOTED
 - 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
 - 6) IDENTIFICATION: NONE
 - 7) WEIGHT: 11.36 lbs

APPROVED

DESIGN	AP	DART AEROSPACE USA, INC.	
DRAWN	AP	KENT, WA	
CHECKED	DW	DRAWING NO.	REV. D
MFG. APPR.	JLM	D4680	SHEET 3 OF 3
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	SKIDTUBE	NTS
DATE	15.03.04	COPYRIGHT © 2013 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition				Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			
Root Cause		FAULT CATEGORY									
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____									
Misidentified ☐	Past Due ☐										